

- SIMPLE LOGGER®
RMS CURRENT MODULE

L100

L110



Owner's Record

The serial number for the Models L100 and L110 is located on the side of the case. Please record this number and purchase date for your records.

SIMPLE LOGGER RMS CURRENT MODEL L100

CATALOG #: 2113.50

SERIAL #: _____

PURCHASE DATE: _____

DISTRIBUTOR: _____

SIMPLE LOGGER RMS CURRENT MODEL L110

CATALOG #: 2113.85

SERIAL #: _____

PURCHASE DATE: _____

DISTRIBUTOR: _____

Table of Contents

1. INTRODUCTION.....	2
1.1 International Electrical Symbols.....	2
1.2 Definition of Measurement Categories.....	3
1.3 Receiving Your Shipment.....	3
1.4 Ordering Information.....	3
1.4.1 Accessories and Replacement Parts.....	3
2. PRODUCT FEATURES	4
2.1 Indicators and Buttons.....	4
2.2 Inputs and Outputs.....	5
2.3 Mounting.....	5
3. SPECIFICATIONS.....	6
3.1 Electrical Specifications.....	6
3.2 Environmental Specifications.....	7
3.3 Mechanical Specifications.....	7
3.4 Safety Specifications.....	7
4. OPERATION	8
4.1 Recording Data.....	8
4.2 Software.....	8
4.2.1 Minimum Computer Requirements.....	8
4.2.2 Installation.....	9
4.2.3 Using the Software.....	9
4.2.4 Function.....	10
5. MAINTENANCE	11
5.1 Battery Installation.....	11
5.2 Cleaning.....	11
APPENDIX A	12
Importing .TXT Files into a Spreadsheet.....	12
Opening a Simple Logger® .TXT file in Excel.....	12
Formatting the Date and Time.....	13
Repair and Calibration.....	15
Technical and Sales Assistance.....	15
Limited Warranty.....	16
Warranty Repairs.....	16

INTRODUCTION

WARNING

- Read the instruction manual completely and follow all safety information before operating this instrument.
- Use caution on any circuit: Potentially high voltages and currents may be present and may pose a shock hazard.
- Read the safety specifications section prior to using the data logger. Never exceed the maximum voltage ratings given.
- Safety is the responsibility of the operator.
- For maintenance, use only original replacement parts.
- NEVER open the back of the instrument while connected to any circuit or input.
- ALWAYS connect the logger to the probe before inserting the probe into the sample being tested.
- ALWAYS inspect the instrument and lead prior to use. Replace any defective parts immediately.
- NEVER use the Simple Logger® Models L100/L110 on electrical conductors rated above 600V in overvoltage Category III.
- ALWAYS use probes rated for 600V working voltage.

1.1 International Electrical Symbols



This symbol signifies that the instrument is protected by double or reinforced insulation. Use only specified replacement parts when servicing the instrument.



This symbol on the instrument indicates a WARNING and that the operator must refer to the user manual for instructions before operating the instrument. In this manual, the symbol preceding instructions indicates that if the instructions are not followed, bodily injury, installation/sample and product damage may result.



Risk of electric shock. The voltage at the parts marked with this symbol may be dangerous.

1.2 Definition of Measurement Categories

- Cat. I:** For measurements on circuits not directly connected to the AC supply wall outlet such as protected secondaries, signal level, and limited energy circuits.
- Cat. II:** For measurements performed on circuits directly connected to the electrical distribution system. Examples are measurements on household appliances or portable tools.
- Cat. III:** For measurements performed in the building installation at the distribution level such as on hardwired equipment in fixed installation and circuit breakers.
- Cat. IV:** For measurements performed at the primary electrical supply (<1000V) such as on primary overcurrent protection devices, ripple control units, or meters.

1.3 Receiving Your Shipment

Upon receiving your shipment, make sure that the contents are consistent with the packing list. Notify your distributor of any missing items. If the equipment appears to be damaged, file a claim immediately with the carrier and notify your distributor at once, giving a detailed description of any damage. Save the damaged packing container to substantiate your claim. Do not use an instrument that appears to be damaged.

1.4 Ordering Information

Simple Logger® Model L100 (0 to 1Vrms)..... **Cat. #2113.50**

Simple Logger® Model L110 (0 to 1Arms)..... **Cat. #2113.85**


Both models include software (CD-ROM), 6 ft DB-9 RS-232 cable, 9V Alkaline battery, set of Velcro® mounting pads and user manual.

1.4.1 Accessories and Replacement Parts

Replacement 6 ft RS-232 cable with DB9F **Cat. # 2114.27**

Order Accessories and Replacement Parts Directly Online
Check our Storefront at www.aemc.com/store for availability

PRODUCT FEATURES

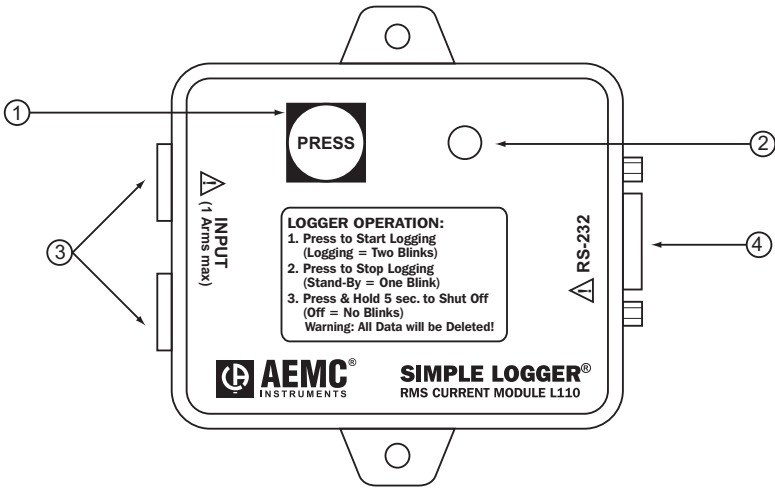

- | | |
|-----------------------|------------------------|
| (1) Start/Stop Button | (3) Input Safety Plugs |
| (2) Red LED Indicator | (4) RS-232 Interface |

2.1 Indicators and Buttons

The Simple Logger® has one button and one indicator. Both are located on the front panel. The PRESS button is used to start and stop recordings and to turn the logger on and off.

The Red LED indicates the status of the logger:

- **Single Blink:** STAND-BY mode
- **Double Blink:** RECORD mode
- **Continuously On:** OVERLOAD condition
- **No Blinks:** OFF mode

2.2 Inputs and Outputs

The left side of the logger incorporates 4mm safety banana jack input connectors compatible with the current probes for which your Simple Logger® was designed.

The right side has a female 9-pin “D” shell serial connector used for data transmission from the logger to your computer.

2.3 Mounting

Your Simple Logger® is equipped with clearance holes in the base plate tabs for mounting. For less permanent mounting, the Velcro® pads (supplied loose) can be attached to the logger and the surface to which it will be mounted.

SPECIFICATIONS

3.1 Electrical Specifications

Number of Channels: 1

Measurement Range:

0 to 10,000Arms (requires optional current probe)

0 to 3000Arms (requires optional current probe)

Input: 0 -1Vrms (L100)

0 - 1Arms (L110)

Input Connection: Recessed Safety Banana Jacks

Resolution: 8 Bits

Scale Range	Maximum Input	Resolution
100%	1A or 1V	0.004A or V
50%	0.5A or 0.5V	0.002A or V
25%	0.25A or 0.25V	0.001A or V
12.5%	0.125A or 0.125V	0.0005A or V

Reference condition: 23°C ± 3K, 20 to 70% RH, Frequency 50/60Hz, No AC external magnetic Field, DC magnetic field ≤ 40A/m, centered conductor, battery voltage 9V ± 10%.

Accuracy: ± 1% Reading + Resolution + Probe Accuracy

Sample Rate:

4096/hr max decreases by 50% each time memory is full

Data Storage: 8192 readings

Data Storage Technique: (TXR™) Time Extension Recording™

Power Supply: 9V Alkaline NEDA 1604, 6LF22, 6LR61

Battery Life Recording: up to 1 year of recording @ 77°F (25°C)

Output: RS-232 via 9 pin "D" shell; 1200 Bps

3.2 Environmental Specifications

Operating Temperature: -4 to 158°F (-20 to 70°C)

Storage Temperature: -4 to 176°F (-20 to 80°C)

Relative Humidity: 5 to 95% non-condensing

3.3 Mechanical Specifications

Size: 2-7/8 x 2-5/16 x 1-5/8" (73 x 59 x 41mm)

Weight (with battery): 5 oz (140g)

Mounting: Base plate mounting holes or Velcro® pads

3.4 Safety Specifications



Working Voltage: EN 61010, 600V, Cat III

**All specifications are subject to change without notice*

OPERATION

4.1 Software Installation

Minimum Computer Requirements

- Windows® 98/2000/ME/NT and XP
- Processor - 486 or higher
- 8MB of RAM
- 8MB of hard disk space for application, 400K for each stored file
- One 9-pin serial port; one parallel port for printer support
- CD-ROM drive

1. Insert the Simple Logger® CD into your CD-ROM drive.
If auto-run is enabled, the Setup program will start automatically. If auto-run is not enabled, select Run from the Start menu and type in **D:\SETUP** (if your CD-ROM drive is drive D. If this is not the case, substitute the appropriate drive letter).
2. The **Set-up** window will appear.

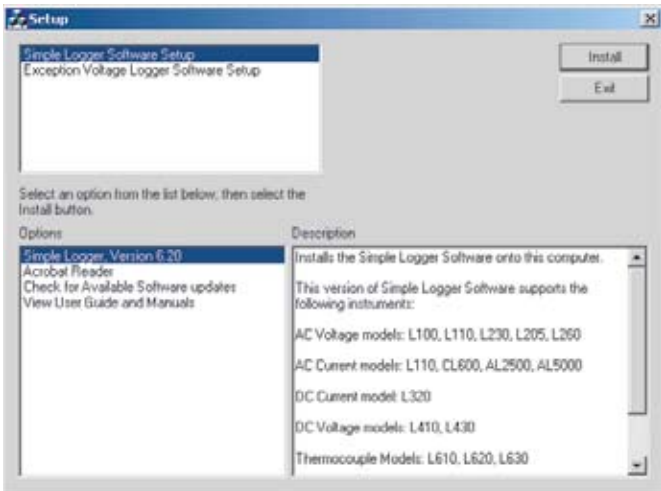


Figure 1

There are a several options to choose from. Some options^(*) require an internet connection.

- **Simple Logger, Version 6.xx** - Installs the Simple Logger[®] software to the computer.
 - ***Acrobat Reader** - Links to the Adobe[®] web site to download the most recent version of Adobe[®] Acrobat Reader. *Acrobat Reader is required for viewing PDF documents supplied on the CD-ROM.*
 - ***Check for Available Software Updates** - Opens the AEMC Software update web site, where updated software versions are available for downloading, if necessary.
 - **View User Guide and Manuals** - Opens Windows[®] Explorer for viewing of documentation files.
3. To install the software, select **Simple Logger Software Setup** in the top section of the Set-up window, then select **Simple Logger, Version 6.xx** in the Options section.
 4. Click the **Install** button and follow the on-screen prompts to install the software.

4.2 Recording Data

- Connect the current probe to the logger and position the probe around the conductor to be measured. Make sure that the jaws are firmly closed before beginning the recording session. (Probe output cannot be more than 1VAC for Model L100 and 1AAC for the Model L110).
- Press the **PRESS** button on the front of the logger to begin the recording session. The indicator light will double-blink to indicate that the recording session has started.
- When the recording session has been completed, press the **PRESS** button to end the recording. The indicator light will single-blink to indicate the recording session has ended and the logger is in Stand-by.
- Unclamp the probe from the conductor and connect the logger to the computer for data downloading. See the User Guide on the CD-ROM for downloading instructions.

4.3 Using the Software

Launch the software and connect the RS-232 cable from your computer to the logger.

NOTE: The first time the program is launched you will need to select a language.

Select **Port** from the menu bar and select the COM port (COM 1, 2 3 or 4) you will be using (see your computer manual). Once the software automatically detects the baud rate, the logger will communicate with the computer. (ID number of the logger and number of points recorded displayed).

Select **Function**, then Simple Logger® L100 or L110 to choose your probe ratio. Select download to display the graph (download takes about 90 seconds).

4.3.1 Function Command

The **Function** command allows you to select the probe or ratio for the recorded data.

When you click on Function, a pull-down window will appear with all the choices supported by the version of software you have installed. This menu will only appear if a Simple Logger® is connected to the COM port.

Simply click on the desired group and then select the proper units from the window that opens. You will be returned to the main screen and the graph Y axis scale will be recalculated using the choice you made here.

Future downloads will use the units selected here for graphing as well. The Simple Logger® communicates to the software its basic configuration. Therefore, you will only be offered choices that are compatible to the logger.

MAINTENANCE

5.1 Battery Installation

Under normal conditions, the battery will last up to a year of continuous recording unless the logger is restarted very frequently.

In the OFF mode, the logger puts almost no load on the battery. Use the OFF mode when the logger is not in use. Replace the battery once a year in normal use.

If the logger will be used at temperatures below 32°F (0°C) or is frequently turned on and off, replace the battery every six to nine months.

1. Make sure your logger is turned off (no blinking light) and all inputs are disconnected.
2. Turn the logger upside down. Remove the four Phillips head screws from the base plate, then take off the base plate.
3. Locate the two-wire (red/black) battery connector and attach the 9V battery to it. Make sure that you observe polarity by lining up the battery posts to the proper terminals on the connector.
4. Once the connector is plugged onto the battery, insert the battery into the holding clip on the circuit board.
5. If the unit is not in record mode after installing the new battery, disconnect it and press the button twice then reinstall the battery.
6. Reattach the base plate using the four screws removed in Step 2.

Your logger is now recording (LED blinking). Press the **PRESS** button for five seconds to stop the instrument.



NOTE: For long-term storage, remove the battery to prevent discharge effects.

5.2 Cleaning

The body of the logger should be cleaned with a cloth moistened with soapy water. Rinse with a cloth moistened with clean water. Do not use solvent.

APPENDIX A

Importing .TXT Files into a Spreadsheet

Opening a Simple Logger .TXT file in Excel

The following example used with Excel Ver. 7.0 or higher.

1. After opening the Excel program, select “*File*” from the main menu and then select “*Open*”.
2. In the dialog box that appears, browse and open the folder where your logger .TXT files are stored. This will be located in **C:\Program Files\Simple Logger 6.xx** if you accepted the default choice offered by the logger installation program.
3. Next, change the file type to “*Text Files*” in the field labeled Files of Type. All the .TXT files in the logger directory should now be visible.
4. Double-click on the desired file to open the Text Import Wizard.
5. Review the selections in the first wizard screen and make sure that the following choices are selected:
Original Data Type: Delimited
Start Import at Row: 1
File Origin: Windows (ANSI)
6. Click the “*NEXT*” button at the bottom of the Wizard dialog box. The second wizard screen will appear.
7. Click on “*Comma*” in the Delimiters box. A check mark should appear.
8. Click the “*NEXT*” button at the bottom of the Wizard dialog box. The third wizard screen will appear.
9. A view of the actual data to be imported should appear in the lower section of the window. Column 1 should be highlighted. In the Column Data Format window, select “*Date*”.
10. Next, click on “*Finish*” to complete the process and import the data.
11. The data will now appear in your spreadsheet in two columns (A and B) and will look similar to that shown in Figure A-1.

A	B
8	Arms
35401.49	3.5
35401.49	5
35401.49	9
35401.49	13.5
35401.49	17
35401.49	20
35401.49	23.5
35401.49	27.5
35401.49	31
35401.49	34.5
35401.49	38

Figure A-1. Sample Data Imported into Excel.

Formatting the Date and Time

Column 'A' contains a decimal number that represents both date and time. Excel can convert this number directly as follows:

1. Click on column 'B' at the top of the column to select the data, then click on *"Insert"* from the main menu and select *"Columns"* from the drop-down menu.
2. Next, click on column 'A' at the top of the column to select the data, then click on *"Edit"* from the main menu and select *"Copy"* to copy the entire column.
3. Click on cell 1 of column 'B' and then click on *"Edit"* and select *"Paste"* to insert a duplicate of column 'A' into column 'B'. This is necessary if you want to show the date and time in two separate columns.
4. Next, click on the top of column 'A', then click on *"Format"* and select *"Cells"* from the drop-down menu.

5. In the dialog box that opens, select the *"Date"* option from the category list on the left. Select the date format you desire and click on *"OK"* to format the column.
6. Click on the top of column 'B', then click on *"Format"* and select *"Cells"* from the drop-down menu.
7. In the dialog box that opens, select the *"Time"* option from the category list on the left. Select the time format you desire and click on *"OK"* to format the column.

Figure A-2 shows a typical spreadsheet with date, time and value displayed. It may be necessary to change the column width to see all the data.

A	B	C
12/02/04	11:45 AM	17
12/02/04	11:45 AM	20
12/02/04	11:45 AM	23.5
12/02/04	11:45 AM	27.5
12/02/04	11:45 AM	31
12/02/04	11:45 AM	34.5
12/02/04	11:45 AM	38
12/02/04	11:45 AM	41.5
12/02/04	11:45 AM	45.5
12/02/04	11:46 AM	49
12/02/04	11:46 AM	52

Figure A-2. Shows Date, Time and Value

Repair and Calibration

To ensure that your instrument meets factory specifications, we recommend that it be scheduled back to our factory Service Center at one-year intervals for recalibration, or as required by other standards or internal procedures.

For instrument repair and calibration:

You must contact our Service Center for a Customer Service Authorization Number (CSA#). This will ensure that when your instrument arrives, it will be tracked and processed promptly. Please write the CSA# on the outside of the shipping container. If the instrument is returned for calibration, we need to know if you want a standard calibration, or a calibration traceable to N.I.S.T. (Includes calibration certificate plus recorded calibration data).

Ship To: Chauvin Arnoux®, Inc. d.b.a. AEMC® Instruments
15 Faraday Drive
Dover, NH 03820 USA
Phone: (800) 945-2362 (Ext. 360)
(603) 749-6434 (Ext. 360)
Fax: (603) 742-2346 or (603) 749-6309
E-mail: repair@aemc.com

(Or contact your authorized distributor)

Costs for repair, standard calibration, and calibration traceable to N.I.S.T. are available.

NOTE: You must obtain a CSA# before returning any instrument.

Technical and Sales Assistance

If you are experiencing any technical problems, or require any assistance with the proper operation or application of your instrument, please call, mail, fax or e-mail our technical support team:

Chauvin Arnoux®, Inc. d.b.a. AEMC® Instruments
200 Foxborough Boulevard
Foxborough, MA 02035 USA
Phone: (800) 343-1391
(508) 698-2115
Fax: (508) 698-2118
E-mail: techsupport@aemc.com
www.aemc.com

NOTE: Do not ship Instruments to our Foxborough, MA address.

Limited Warranty

The Simple Logger® Model L100/L110 is warranted to the owner for a period of one year from the date of original purchase against defects in manufacture. This limited warranty is given by AEMC® Instruments, not by the distributor from whom it was purchased. This warranty is void if the unit has been tampered with, abused or if the defect is related to service not performed by AEMC® Instruments.

For full and detailed warranty coverage, please read the Warranty Coverage Information, which is attached to the Warranty Registration Card (if enclosed) or is available at www.aemc.com. Please keep the Warranty Coverage Information with your records.

What AEMC® Instruments will do:

If a malfunction occurs within the one-year period, you may return the instrument to us for repair, provided we have your warranty registration information on file or a proof of purchase. AEMC® Instruments will, at its option, repair or replace the faulty material.

**REGISTER ONLINE AT:
www.aemc.com**

Warranty Repairs

What you must do to return an Instrument for Warranty Repair:

First, request a Customer Service Authorization Number (CSA#) by phone or by fax from our Service Department (see address below), then return the instrument along with the signed CSA Form. Please write the CSA# on the outside of the shipping container. Return the instrument, postage or shipment pre-paid to:

Ship To: Chauvin Arnoux®, Inc. d.b.a. AEMC® Instruments
15 Faraday Drive • Dover, NH 03820 USA
Phone: (800) 945-2362 (Ext. 360)
(603) 749-6434 (Ext. 360)
Fax: (603) 742-2346 or (603) 749-6309
E-mail: repair@aemc.com

Caution: To protect yourself against in-transit loss, we recommend you insure your returned material.

NOTE: You must obtain a CSA# before returning any instrument.



05/07

99-MAN 100209 v11